

Date: Monday, 5/15/2006 10:48:59 AM  
 User: Kim Johnston

## Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: 206 L HIGH GEAR SKIDTUBE
Job Number	: 27095A		
Estimate Number	: 10522		
P.O. Number	: N/A	Part Number	: D206642441
This Issue	: 5/15/2006	S.O. No.	: N/A
Prsht Rev.	: NC	Drawing Number	: D2650 REV E
First Issue	: N/A	Project Number	: N/A
Previous Run	: 27094A	Drawing Revision	: E
	Type : LANDING GEAR	Material	: N/A
Written By	: <u>SEE COMMENT BELOW</u>	Due Date	: 6/2/2006
Checked & Approved By	: <u>06.05.15</u>	Qty:	1 Um: Each
Comment	: Est Rev: H 05.10.11 Added D3429-1 per CHG004 KJ/CP/JLM		

## Additional Product

Job Number:



Seq. #:

Machine Or Operation:

Description :

1.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels per PPP D206-642-441 CHG002

KS 06-05-18

2.0

D2620

Bent 206 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2620

Bent Tube 3" OD

B 27205 BE 06-06-05

3.0

D2647

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2647

Fwd Cap

B 20535 BE 06-06-13

4.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube BE 06-06-05

2-Remove ridge on inside of Fwd edge of tube as per Dwg D2650 BE 06-06-05

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

A/R Aluminum Rod

B 20535 BE 06-06-13

M18839/M100660

4-Grind weld flush to cap on top surface only. BE 06-06-13

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Date: Monday, 5/15/2006 10:49:00 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27095A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

8.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

*DP 06-6-21*

9.0

D2649

Crossbolt Spacer



Comment: Qty.: 23.0000 Each(s)/Unit Total: 23.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

23 D2649

Crossbolt spacer

*325864 BE 06-06-21*

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert cross bolt spacers D2649. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

A/R Aluminum Rod

*M18839 BE 06-06-21*

2-Grind welds flush as per Dwg D2650. Masking Tape access to inside of the Skidtube

*BE 06-06-26*

3-Counterbore 5/16" x 0.750" deep as per Dwg D2650Deburr

*BE 06-06-26*

11.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2680-041

Nut Plate

*B24203 BE 06-06-27*

12.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 CCR264SS3-3

Rivets

*M14651 BE 06-06-27*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Date: Monday, 5/15/2006 10:49:00 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27095A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

M7885343

Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 M7885/3-4-3

Rivets

*m19099 BE 06-06-27*

14.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

*BE 06-06-27*

15.0

QC5/9

WELD INSPECTION



*QC9 -> PD 06-06-27 (1)*

*06-06-27 (1)*

Comment: WELD INSPECTION

16.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White (Ref. 4.3.5.1) as per QSI 005 4.3

Make sure Nut Plate Thread protected use paint screw

*A-M 06-07-05*

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

*DL 06/07/06 (1)*

18.0

D26483

Wearpad



Comment: Qty.: 6.0000 Each(s)/Unit Total : 6.0000 Each(s)

Pick:

Qty Part Number

Description Batch

6 D2648-3

Wearpad

*B25904*

19.0

D265615

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-15

Wearshoe

*B24845*

*DL 06/07/06 (1)*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Date: Monday, 5/15/2006 10:49:00 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27095A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

D265623

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-23

Wearshoe B22085

21.0

D265637

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-37

Wearshoe B26366

22.0

D34291



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D3429-1

Wearpad B24417

23.0

ALS41032130

Insert



Comment: Qty.: 60.0000 Each(s)/Unit Total : 60.0000 Each(s)

Pick:

Qty Part Number

Description Batch

60 ALS4-1032-130

Inserts M18293

or (see QSI 017)

24.0

AN960JD10L

Washer



Comment: Qty.: 60.0000 Each(s)/Unit Total : 60.0000 Each(s)

Pick:

Qty Part Number

Description Batch

60 AN960JD10L

Washer M18235

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_



Date: Monday, 5/15/2006 10:49:00 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27095A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

25.0

MS27039108

Screw



Comment: Qty.: 60.0000 Each(s)/Unit Total : 60.0000 Each(s)

Pick:

Qty Part Number

Description Batch

60 MS27039-1-08

Screw M18836

26.0

D26511

Plug



Comment: Qty.: 22.0000 Each(s)/Unit Total : 22.0000 Each(s)

Pick:

Qty Part Number

Description Batch

22 D2651-1

Plugs B25365

27.0

D26513

O-Ring



Comment: Qty.: 22.0000 Each(s)/Unit Total : 22.0000 Each(s)

Pick:

Qty Part Number

Description Batch

22 D2651-3

O-Rings B23491

28.0

AN960JD416

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 AN960JD416

Washer M11151

29.0

MS27039406

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 MS27039-4-06

Screw M16874

DL 04/07/06 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Date: Monday, 5/15/2006 10:49:00 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27095A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

30.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2646

Aft Cap B25381

31.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 AN960JD10L

Washer M18235

32.0

MS27039108

Screw



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 MS27039-1-08

Screw M18836

DL 06/07/06 ①

33.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291

M101193

Sikaflex expiry date:

11/09

2-Install O-Rings D2651-3 on plugs D2651-1 with Petroleum Jelly and install plugs as per Dwg D2650. Clean excess adhesive

3-Install MS27039-4-06 Screw as per DEO 9153

4-Inspect for foreign object per QSI 024

5-Install D2646 Aft Cap and seal with SikaflexClean excess adhesive

A/R Sikaflex-291

M101193

Sikaflex expiry date:

11/06

6-Wing Walk as per Dwg D2650-7 and QSI 005 4.4

Batch: M101266

FL 06 07 10 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☐ No ☒ DQA: 27 Date: 08/01/12

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Date: Monday, 5/15/2006 10:49:01 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27095A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

34.0

QC3/5

INSPECT WORK/WING WALK



Comment: INSPECT WORK/WING WALK

*Jan 11 11*

35.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: *N/A*

*6/2/11*

36.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

*D06/07/12 1*

Job Completion



*u D6-87 u*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

**DART**RELEASED  
16 04 17 #

DESIGN 147	DRAWN BY 147	<b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	
CHECKED PH	APPROVED H	DRAWING NO. D2650	REV. E SHEET 1 OF 5
DATE 06.03.30		TITLE 206/407 SKIDTUBE ASSEMBLIES	SCALE NTS
A	97.03.25	NEW ISSUE	
B	97.06.26	AS MANUFACTURED CHANGES	
C	97.10.29	CHANGE HOLE PATTERN AND FRONT END	
D	04.05.17	REDRAW; INCORP. DE09136/9153/9163 MOD GROUND HNDLNG ON D2650-1/-3	
E	06.03.30	RMV C'BORE, CHG DRILL, ADD CHAMFER	

Qty -1	Qty -3	Qty -5	Qty -7	Part Number	Description
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
16	17	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 27095A**NOTES**

- 1) WELD PER DART QSI 004
- 2) DAMAGE TOLERANCE ON FWD BEND:  
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 3) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- 4) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 5) FINISH:  
-CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3  
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 6) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 7) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED




Copyright © 1997 by DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.







1:10

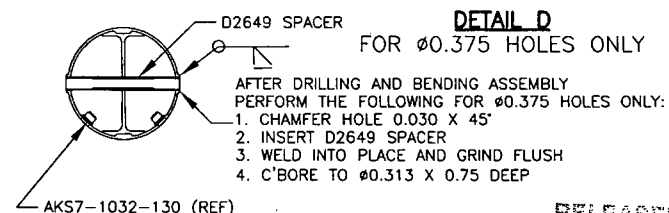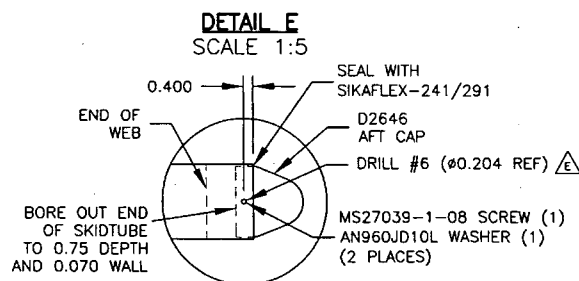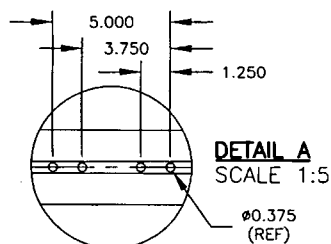


RELEASED

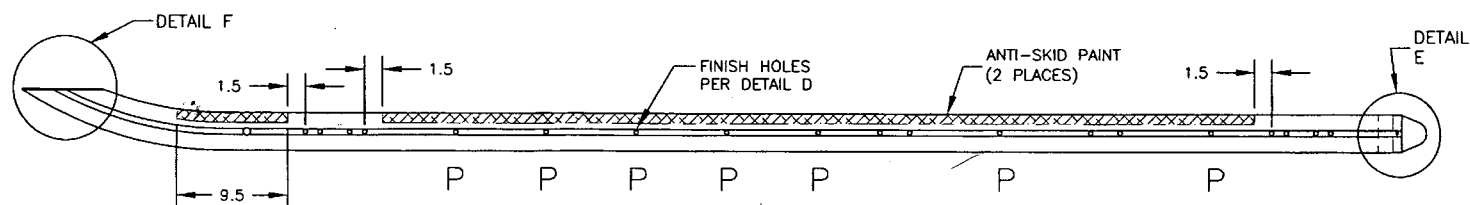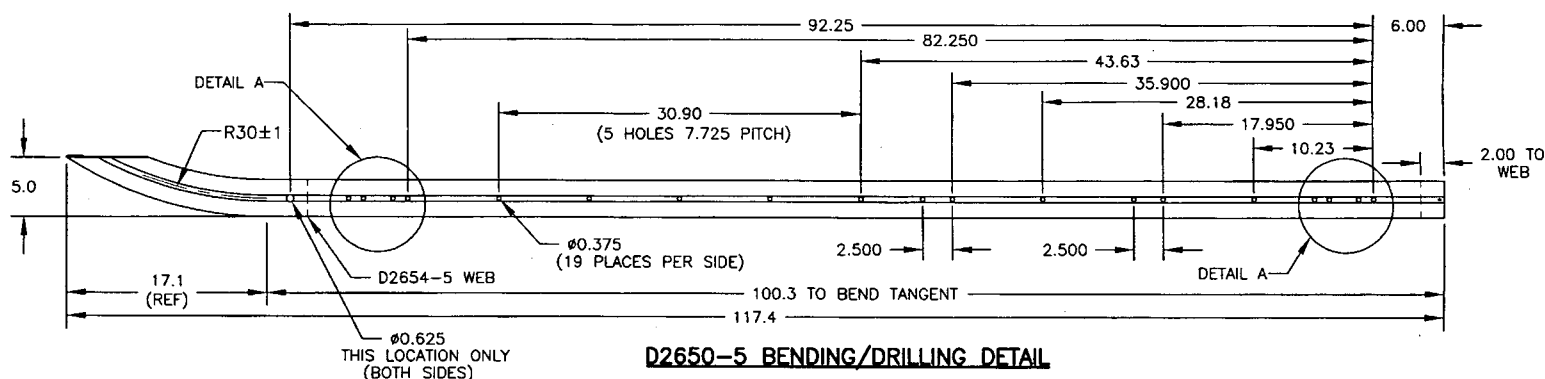

**DETAIL F (NOT TO SCALE)**

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE

 NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH



- CCR264SS3-3 RIVET (2 PLACES)
- MS27039-4-06 SCREW (1)
- AN960JD416 WASHER (1)
- CR3212-4-03 RIVET (2 PLACES)
- D2680-041 NUTPLATE (1)
- D2647 CAP (1)

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	DRAWN BY	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED	PH	APPROVED	PH	DRAWING NO.	REV. E
DATE	06.03.30	TITLE	SKIDTUBE	D2650	SHEET 4 OF 5
					SCALE 1:10

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
210954

TITLE	SCALE
SKIDTUBE	1:10